

1531

RATIFIED BY THE BERRIEN COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 445 OF 1990

*[Signature]*  
10-23-97  
For corners in

RECORDED  
RECORDED

BERRIEN COUNTY REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

97 NOV -3 AM 10: 29

BERNICE TRETHERWAY REGISTER OF DEEDS BERRIEN COUNTY, MICHIGAN

N  
E  
2372881.708 102430.136


Located In:	Corner Code #
Berrien (County)	
1. Public Land Survey	T 8S R19W I-9
	T R
	T R
	T R
	T R
2. Property Controlling in Section	S T R
	S T R
3. Miscellaneous Property in Sec.	S T R
	S T R

11/03/97 111#2536 A99  
CORNER \$7.00  
11/03/97 111#2536 A99  
STATE REMON. FEE \$2.00  
Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

I, V. I. Strebs, in a field survey on October 20, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

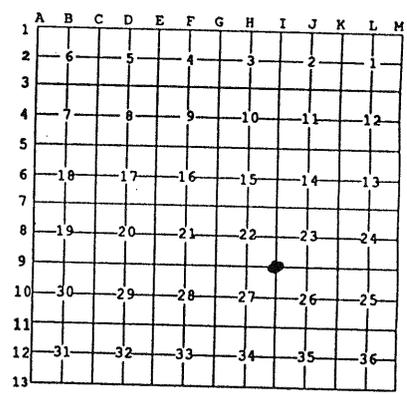

A. Description of original monument and accessories and/or subsequent restoration:

- 1830 LUCIUS LYON D.S.  
SET POST 12.15 CHAINS EAST OF 17TH MILE POST ON STATE BOUNDARY  
6" WHITEWOOD - N 37° E - 18 LINKS  
6" BEECH - N 20 1/4° W - 36 LINKS
- 1886 ALBERT DREW COUNTY SURVEYOR  
SET CAST IRON BAR & STONE, 12.15 CHAINS EAST OF 17TH MILE POST  
10" POPLAR - 65° E 7.5 LINKS

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- FOUND CAST IRON BAR WITH STONES 0.48' EAST OF RAILROAD RAIL FENCE POST

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

REMOVED CAST IRON BAR AND REPLACED WITH STANDARD CONCRETE MONUMENT WITH BRASS CAP, (STAMPED "26469/1997")  
SET NAIL W/TAG IN 16" TULIP - N 10° E - 25.35'  
SET NAIL W/TAG IN 8" OAK - S 30° E - 48.75'  
SET NAIL W/TAG IN 18" OAK - S 30° E - 0.48'  
FACE OF RAILROAD RAIL FENCE POST - EAST 0.48'

Corner is accepted as a careful and faithful perpetuation of the position of the original corner.

Signed by *[Signature]*  
Surveyor's Michigan License No. 26469

Date 31 OCTOBER 1997



FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN, 1983  
REVISED OCT, 1985